



Model	Model Code	Year Model	Issue Date
CIVIC 3D	FN1, FN2, FN3, FN4	07, 08, 09, 10	29-11-10
CIVIC 5D	FK1, FK2, FK3	06, 07, 08, 09, 10	Originator Product Technical/QIC HUK (United Kingdom)

## Powered Door Mirrors Do Not Fold Civic 3 & 5 Door Only (LON Information Revised)

### Symptom


The customer may report loss of the door mirror's power fold function (either intermittently or completely, or slow operation of the power fold function).

The customer could report these happening on either driver's or passenger's door mirror - or both.

### Cause

The shut off device within the door mirror fails.

Please refer to image A below for location of the Shut off device.

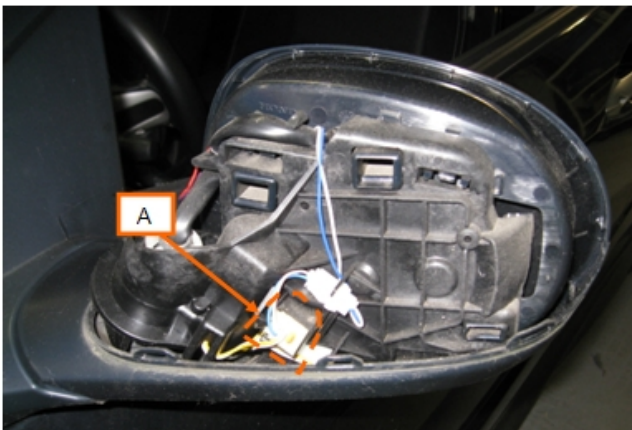

### Countermeasure

The shut off device has been modified.

Previously the repair for this symptom would have been to replace the entire mirror assembly, however the shut off device has now been made available as a service part.

If these symptom are encountered, replace the shut off device only.

### Application to Production Line

```
SHHFN1 ***AU001570
SHHFN2 ***AU002116
SHHFN3 ***AU000970
SHHFN4 ***AU003430
SHHFK1 ***AU001857
SHHFK2 ***AU019370
SHHFK3 ***AU008510
```

The new type of shut off device was fitted to the mirror assemblies from the VIN shown above.

### Repair Method

1. Remove the upper casing from the mirror assembly by applying a firm, yet steady, force to the casing in the direction indicated below.


Care must be taken to ensure that there is no damage caused.




Be aware that there is a harness leading to the indicator lamp which must also be disconnected to allow full removal of the upper casing. See Picture A & B below

2. Remove the upper most 2 pin coupler (A) from it's locating clip, and disconnect the coupler by depressing the locking tab and separating the male and female parts.

Note; Pay attention to the routing of the harness (B) within the mirror assembly as you will need to re-route the harness when you install the replacement shut off device.

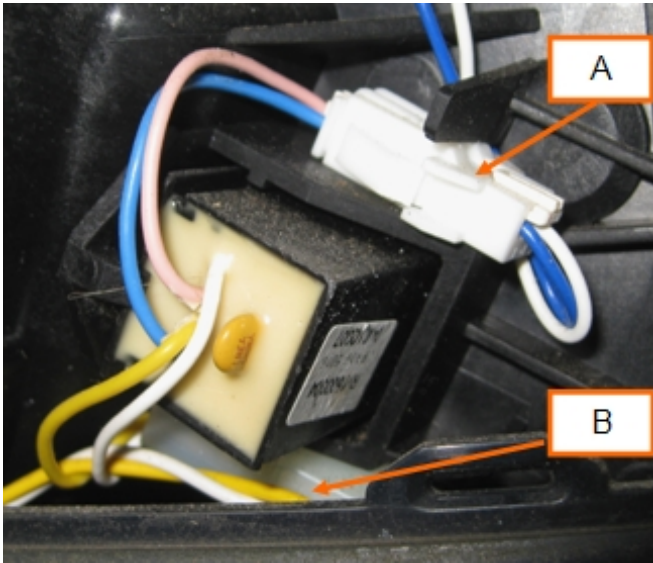


3. Remove the shut off device by using a trim tool to disengage the locating tab and withdrawing it from it's housing as shown in figure C below.

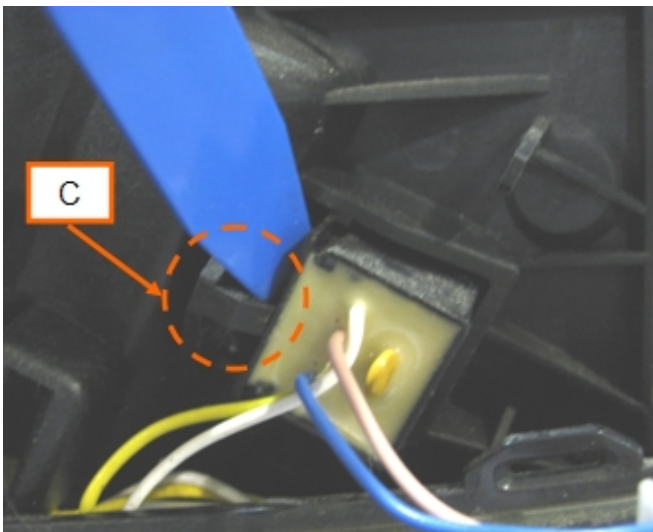

4. With the shut off device removed, disconnect the lower coupler by pulling the two parts of the coupler apart - there is no locking tab on this coupler.

Note: Careful attention to the harness routing & coupler location must be made as you will need to ensure correct routing and location when installing the replacement part.

5. Instal the new shut off device in the reverse order of removal.

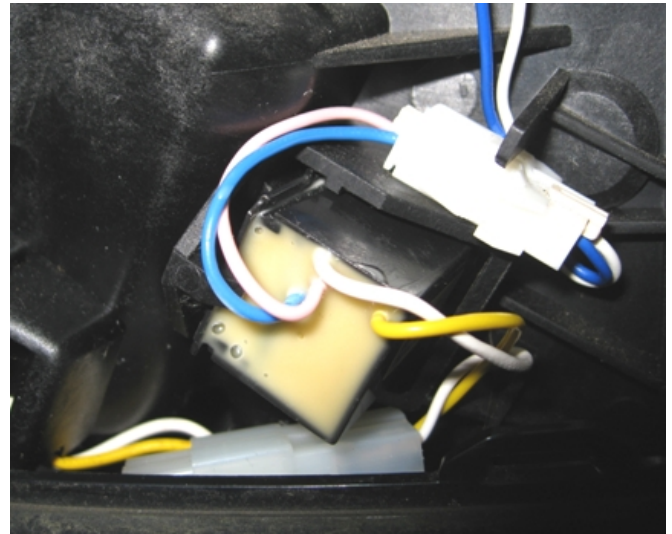

**Parts Information**

<Part Number>	<Part Name>
76209-SMG-E01	Shut Off Device Unit

The Shut Off Device has now been made available as a service part. There is one shut off device for each mirror.

**Warranty Information**

**Application:** Normal Warranty

**Causal Part:** 76209-SMG-E01

**NEWS Symptom Code:** 03265 (Control Malfunction)

**Operation No.(LON-NEWS Only):**

LON	Description	FRT
8201C6	Replace 1 Mirror Shut Off Device.	0.4
<b>8201C7</b>	Replace Both Mirror Shut Off Device.	0.7